

<- Back Forward ->

Document ID# 1772397
2006 Pontiac Solstice

Feedback Print

**Subject: Waterleak from Around the Rear Glass Panel -
keywords canvas convertible drop roof top wet
#PIC3908A - (02/27/2006)**



Models: 2006 Pontiac Solstice

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern:

A waterleak into the interior of a Solstice from the rear glass may occur because the rear glass has separated from the convertible top.

Recommendation/Instructions:

If you have this condition, DO NOT replace the convertible top canvas or top assembly. To repair this concern, clean the top canvas material in the effected area of any debris then seal the area bond the top to window area using 3M Fast Cure Auto Glass Urethane (High Viscosity) P/N 051135-08689 (450 ml) or 051135-06890 (10.5 fl. oz cartridge) or GM 3615G.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT
VOLUNTARY
TECHNICIAN
CERTIFICATION